

## Dry location boxes

### 347 volt FS box kits – 1 1/2 in. deep (cast aluminum)



	Cat. no.	Hub size (in.)	No. of gangs	No. of lugs	Std. ctn.
CIFS-1G-1/2-HV	CIFS-1G-1/2-HV	1 x 1/2	1	3	5
CIFS-1G-3/4-HV	CIFS-1G-3/4-HV	1 x 3/4	1	3	5



**For dry location only**


Includes stamped aluminum "CIFS-9HV" 347 V covers (not raintight)

### 347 volt FS box kits – 1 1/2 in. deep (cast aluminum)



Cat. no.	Hub size	A	B	C	D	E	F	G	H	J	CI
CIFS-1G-1/2-HV	1 x 1/2	4 3/8	2 13/16	1 3/16	1 7/8	1 1/4	2 7/8	2 5/16	1 1/16	-	14.0
CIFS-1G-3/4-HV	1 x 3/4	4 3/8	2 13/16	1 3/16	1 7/8	1 1/2	2 7/8	2 5/16	1 1/16	-	14.0

**Diagrams**

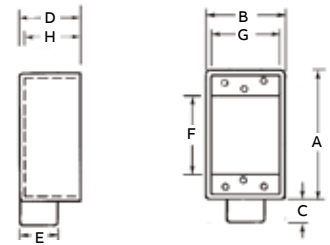

CIFS-1G-1/2-HV / CIFS-1G-3/4-HV

Includes stamped aluminum "CIFS-9HV" 347 V covers (not raintight)

### Universal FSU boxes – 2 3/8 in. deep (cast aluminum)



	Cat. no.	Hub size (in.)	No. of gangs	No. of lugs	Std. ctn.
CIFSU	CIFSU-1/2	2 x 1/2	1	2	20
	CIFSU-3/4	2 x 3/4	1	2	20



**For dry location only**


Supplied with close up plugs.

### Universal FSU boxes – 2 3/8 in. deep (cast aluminum)



Cat. no.	Hub size	A	B	C	D	E	F	G	H	K	CI
CIFSU-1/2	2 x 1/2	4 5/16	2 3/4	1 3/16	2 3/8	1 1/8	2 13/16	2 1/2	1 29/32	7/16	18.5
CIFSU-3/4	2 x 3/4	4 5/16	2 3/4	1 3/16	2 3/8	1 1/8	2 13/16	2 1/2	2	7/16	18.5

**Diagrams**

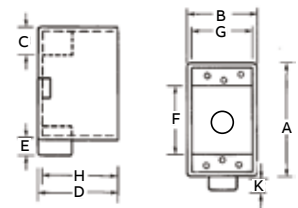

CIFSU

Supplied with close up plugs.